# VICTOR B SEELEY DITCH IMPROVEMENT No. 2227

LAKE TOWNSHIP — WOOD COUNTY OHIO

ORTON H JONES — COUNTY ENGINEER

OCTOBER 1962 — DITCH BOOK 131

The 54" pipe at the Pemberville road is only one half the capacity required by this drainage area, A study is under way by the engineering department to determin the best method for correcting this condition

The cutoff wall at the N.Y.C. R.R. bridge shall be removed by contractor under direction of the engineer.

2' Bottom 1½ To 1 Slope except as shown on cross sections

| STA. | HUB ELEV. | GRADE | CUT | CU. YDS. |
|---|---|---|---|---|
| 0 | 620.20 | 617.00 | 3.20 | |
| 1 | 619.56 | 616.66 | 2.90 | |
| 2 | 619.59 | 616.32 | 3.27 | 73 |
| 3 | 619.64 | 615.98 | 3.66 | |
| 4 | 619.93 | 615.64 | 4.29 | 73 |
| 5 | 619.82 | 615.30 | 4.52 | |
| 6 | 619.76 | 615.15 | 4.61 | 89 |
| 7 | 619.71 | 615.00 | 4.71 | |
| 8 | 619.71 | 614.85 | 4.86 | 110 |
| 9 | 619.75 | 614.70 | 5.05 | |
| 10 | 619.77 | 614.55 | 5.22 | 128 |
| 11 | 619.94 | 614.40 | 5.54 | |
| 12 | 620.27 | 614.25 | 6.02 | 128 |
| 13 | 620.06 | 614.10 | 5.96 | |
| 14 | 619.93 | 613.95 | 5.98 | 128 |
| 15 | 619.85 | 613.80 | 6.05 | |
| 16 | 619.98 | 613.65 | 6.33 | 136 |
| 17 | 619.09 | 613.50 | 5.59 | |
| 18 | 619.57 | 613.35 | 6.22 | 151 |
| 19 | 619.22 | 613.20 | 6.02 | |
| 20 | 618.89 | 613.05 | 5.84 | 151 |
| 21 | 618.75 | 612.90 | 5.85 | |
| 22 | 618.09 | 612.75 | 5.34 | 121 |
| 23 | 617.98 | 612.60 | 5.38 | |
| 24 | 617.95 | 612.45 | 5.50 | 93 |
| 25 | 618.09 | 612.30 | 5.79 | |
| 26 | 616.98 | 612.15 | 4.83 | 89 |
| 27 | 616.66 | 612.00 | 4.66 | |
| 28 | 616.40 | 611.85 | 4.55 | 105 |
| 29 | 617.04 | 611.70 | 5.34 | |
| 30 | 616.21 | 611.55 | 4.66 | 93 |
| 31 | 616.95 | 611.40 | 5.55 | |
| 32 | 616.34 | 610.74 | 5.60 | 112 |
| 33 | 616.19 | 610.67 | 5.52 | |
| 34 | 615.94 | 610.60 | 5.34 | 150 |
| 35 | 616.18 | 610.53 | 5.65 | |
| 36 | 615.85 | 610.46 | 5.39 | 139 |
| 37 | 615.58 | 610.39 | 5.19 | |
| 38 | 616.44 | 610.32 | 6.12 | 128 |
| 39 | 615.76 | 610.25 | 5.51 | |
| 40 | 616.01 | 610.18 | 5.83 | 128 |
| 41 | 615.27 | 610.11 | 5.16 | |
| 42 | 615.51 | 610.04 | 5.47 | 136 |
| 43 | 614.79 | 609.97 | 4.82 | |
| 44 | 614.68 | 609.90 | 4.78 | 109 |
| 45 | 614.88 | 609.83 | 5.05 | |
| 46 | 615.26 | 609.76 | 5.50 | 103 |
| 47 | 615.63 | 609.69 | 5.94 | |
| 48 | 614.68 | 609.62 | 5.06 | 110 |
| 49 | 614.86 | 609.55 | 5.31 | |
| 50 | 614.77 | 609.48 | 5.29 | 98 |
| 51 | 614.87 | 609.41 | 5.46 | |
| 52 | 615.31 | 609.34 | 5.97 | 103 |
| 53 | 614.52 | 609.27 | 5.25 | |
| 54 | 614.51 | 609.20 | 5.31 | 121 |
| 55 | 614.14 | 609.13 | 5.01 | |
| 56 | 613.94 | 609.06 | 4.88 | 113 |
| 57 | 613.92 | 608.99 | 3.93 | |
| 58 | 614.61 | 608.92 | 4.69 | 106 |
| 59 | 614.86 | 608.85 | 6.01 | |
| 60 | | | | 78 |
| 61 | | | | |
| 62 | 613.21 | 608.10 | 5.11 | 25 |
| 63 | 613.63 | 608.00 | 5.63 | |
| 64 | 613.10 | 607.90 | 5.20 | 83 |
| 65 | 613.01 | 607.80 | 5.21 | |
| 66 | 612.13 | 607.70 | 4.43 | 106 |
| 67 | 612.58 | 607.60 | 4.98 | |
| 68 | 612.61 | 607.50 | 5.11 | 106 |
| 69 | 613.76 | 607.40 | 6.36 | |
| 70 | 613.42 | 607.30 | 6.12 | 98 |
| 71 | 612.94 | 607.20 | 5.74 | |
| 72 | 613.18 | 607.10 | 6.08 | 89 |
| 73 | 612.76 | 607.00 | 5.76 | |
| 74 | 612.79 | 606.90 | 5.89 | 69 |
| 75 | 612.74 | 606.80 | 5.94 | |
| 76 | 612.43 | 606.70 | 5.73 | 61 |
| 77 | 612.42 | 606.60 | 5.82 | |
| 78 | 612.16 | 606.50 | 5.66 | 73 |
| 79 | 612.07 | 606.40 | 5.67 | |
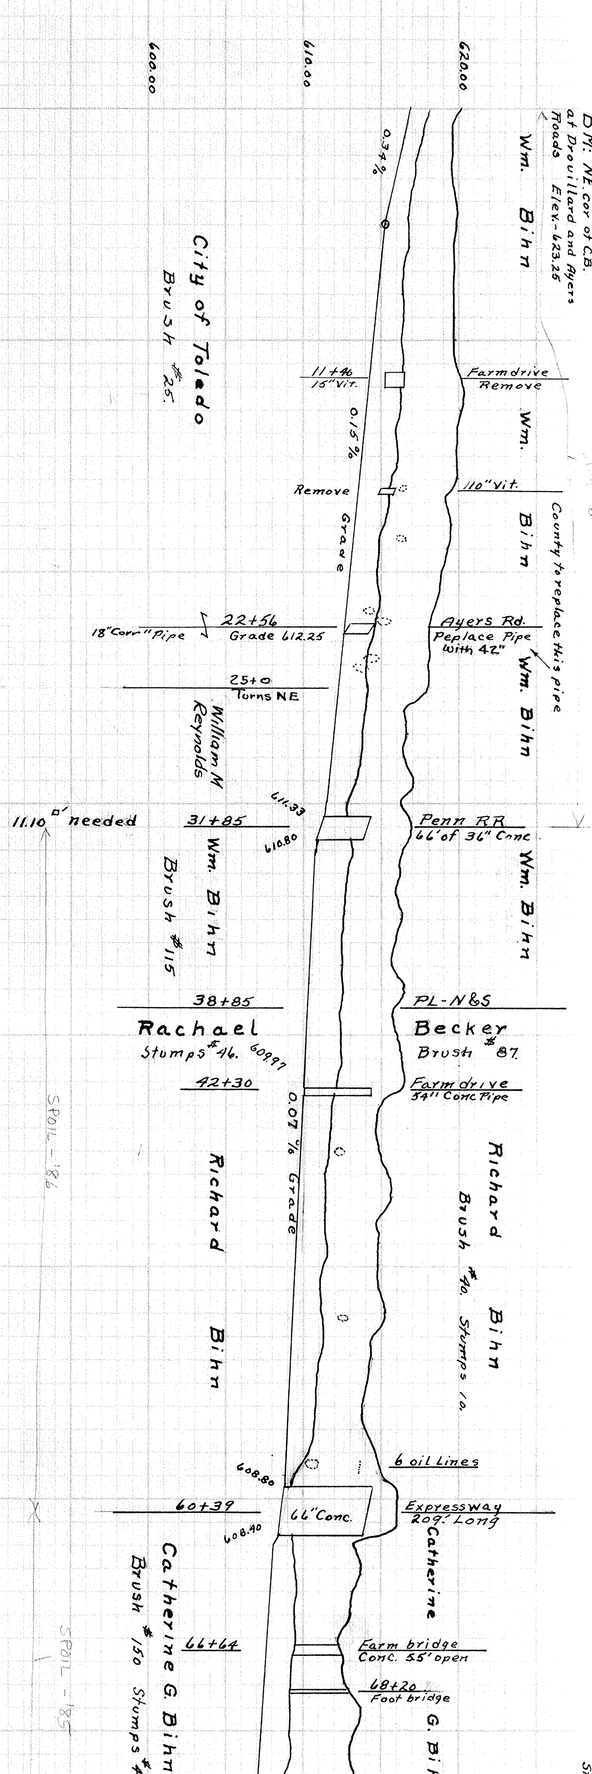
Clean all bridges full width