PROFILE OF
C.H. DIERKSHEIDE DITCH No 2152
FREEDOM & MONTGOMERY TOWNSHIPS
WOOD COUNTY OHIO
DITCH BOOK 133 ORTON H. JONES
February 1958 COUNTY ENGINEER

2 foot bottom with 1¾ to1
Slopes on Main and Branch.

No stumps are to be removed from the cinder bank on the west side of ditch. The railroad bank or west bank is not to be cut. The present slope is to continue down to the new bottom. All brush on this bank shall be cut at ground level - Brush to be cut from present water level to a point forty inches above water level measured along bank slope

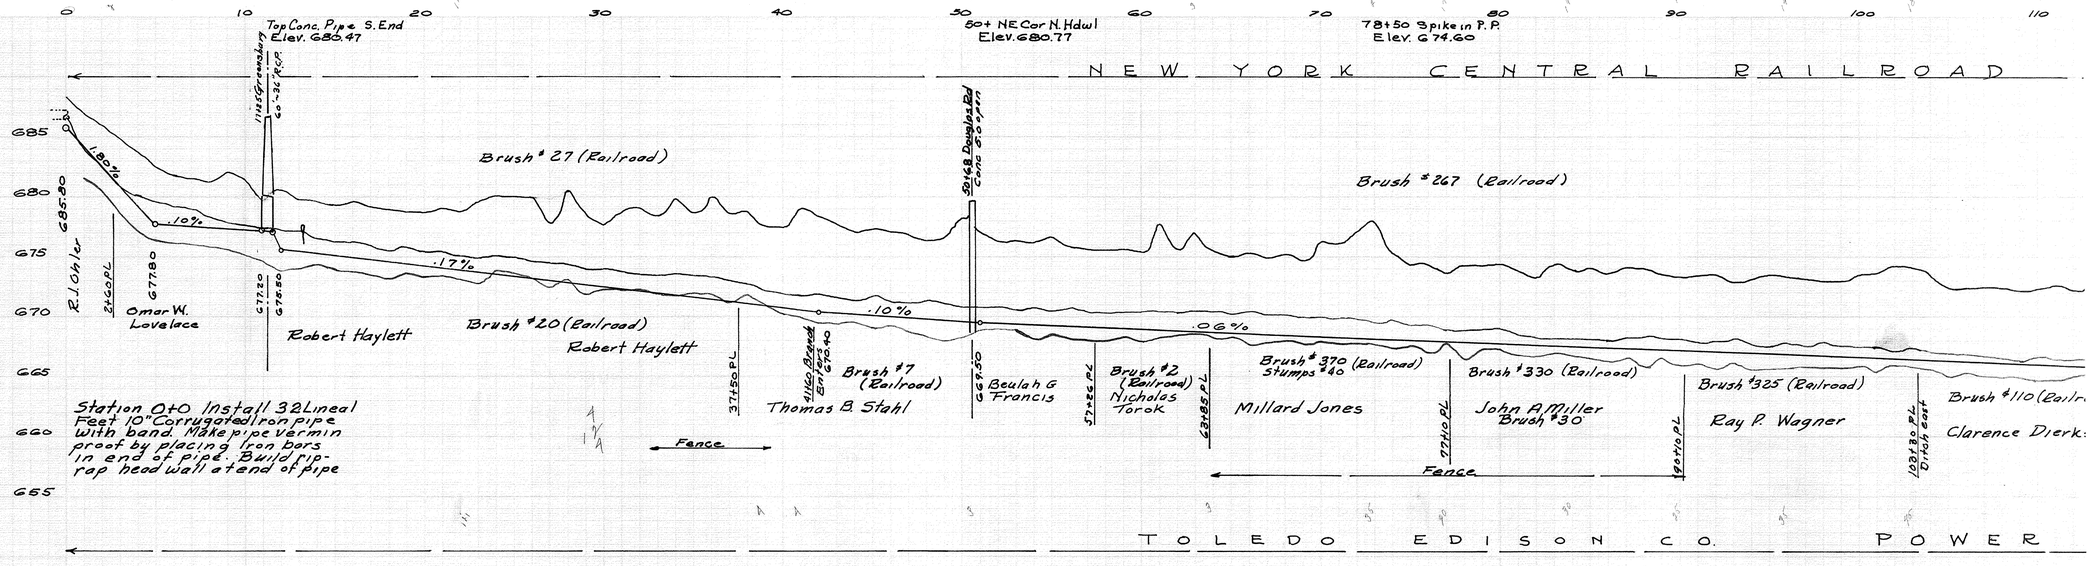

Station	Cut	Cubic Yards	Extra Yardage For Light Cut
0	2.46		
1	2.80	26	
2	3.39	34	14
3	3.86	43	
4	4.35	52	6
5	4.63	60	
6	4.00	63	
7	3.97	60	
8	3.77	59	
9	4.59	63	
10	4.16	58	2
11	7.56	48	
12	5.12	56	
13	4.42	48	
14	4.20	48	
15	4.32	46	
16	4.81	46	
17	4.53	46	
18	4.47	46	
19	4.46	46	
20	4.67	46	
21	5.06	46	
22	4.95	46	
23	5.18	46	
24	5.57	46	
25	6.11	46	
26	6.92	46	
27	4.97	46	
28	7.68	46	
29	5.75	46	
30	5.25	46	
31	6.52	46	
32	7.10	46	
33	6.95	46	
34	8.12	46	
35	7.15	46	
36	8.56	46	
37	7.28	46	
38	7.81	46	
39	6.55	46	
40	6.78	46	
41	8.49	46	
42	8.05	46	
43	7.45	46	
44	6.87	46	
45	7.21	46	
46	7.19	46	
47	6.99	46	
48	6.63	46	
49	6.85	46	
50	8.64	46	
51	7.52	46	
52	6.91	46	
53	7.02	46	
54	6.93	46	
55	7.44	46	
56	6.62	46	
57	6.43	46	
58	6.56	46	
59	7.58	46	
60	6.49	46	
61	8.78	46	
62	6.64	46	
63	8.18	46	
64	6.79	46	
65	6.40	46	
66	6.79	46	
67	6.93	46	
68	6.72	46	
69	6.39	46	
70	7.76	46	
71	7.81	46	
72	8.84	46	
73	9.80	46	
74	7.23	46	
75	6.21	46	
76	6.31	46	
77	5.77	46	
78	6.47	46	
79	6.46	46	
80	6.63	46	
81	6.14	46	
82	5.63	46	
83	6.87	46	
84	6.40	46	
85	6.62	46	
86	6.30	46	18
87	6.78	46	
88	6.68	46	
89	6.28	46	
90	6.11	46	
91	6.33	46	
92	6.42	46	
93	5.95	46	
94	6.19	46	
95	6.61	46	
96	6.59	46	
97	6.36	46	
98	6.31	46	
99	6.36	46	
100	7.00	46	
101	7.10	46	
102	7.81	46	
103	7.66	46	
104	7.26	46	
105	6.03	46	
106	6.20	46	
107	6.36	46	
108	6.31	46	
109	6.19	46	
110	6.40	46	
111	6.28	46	
112	6.26	46	