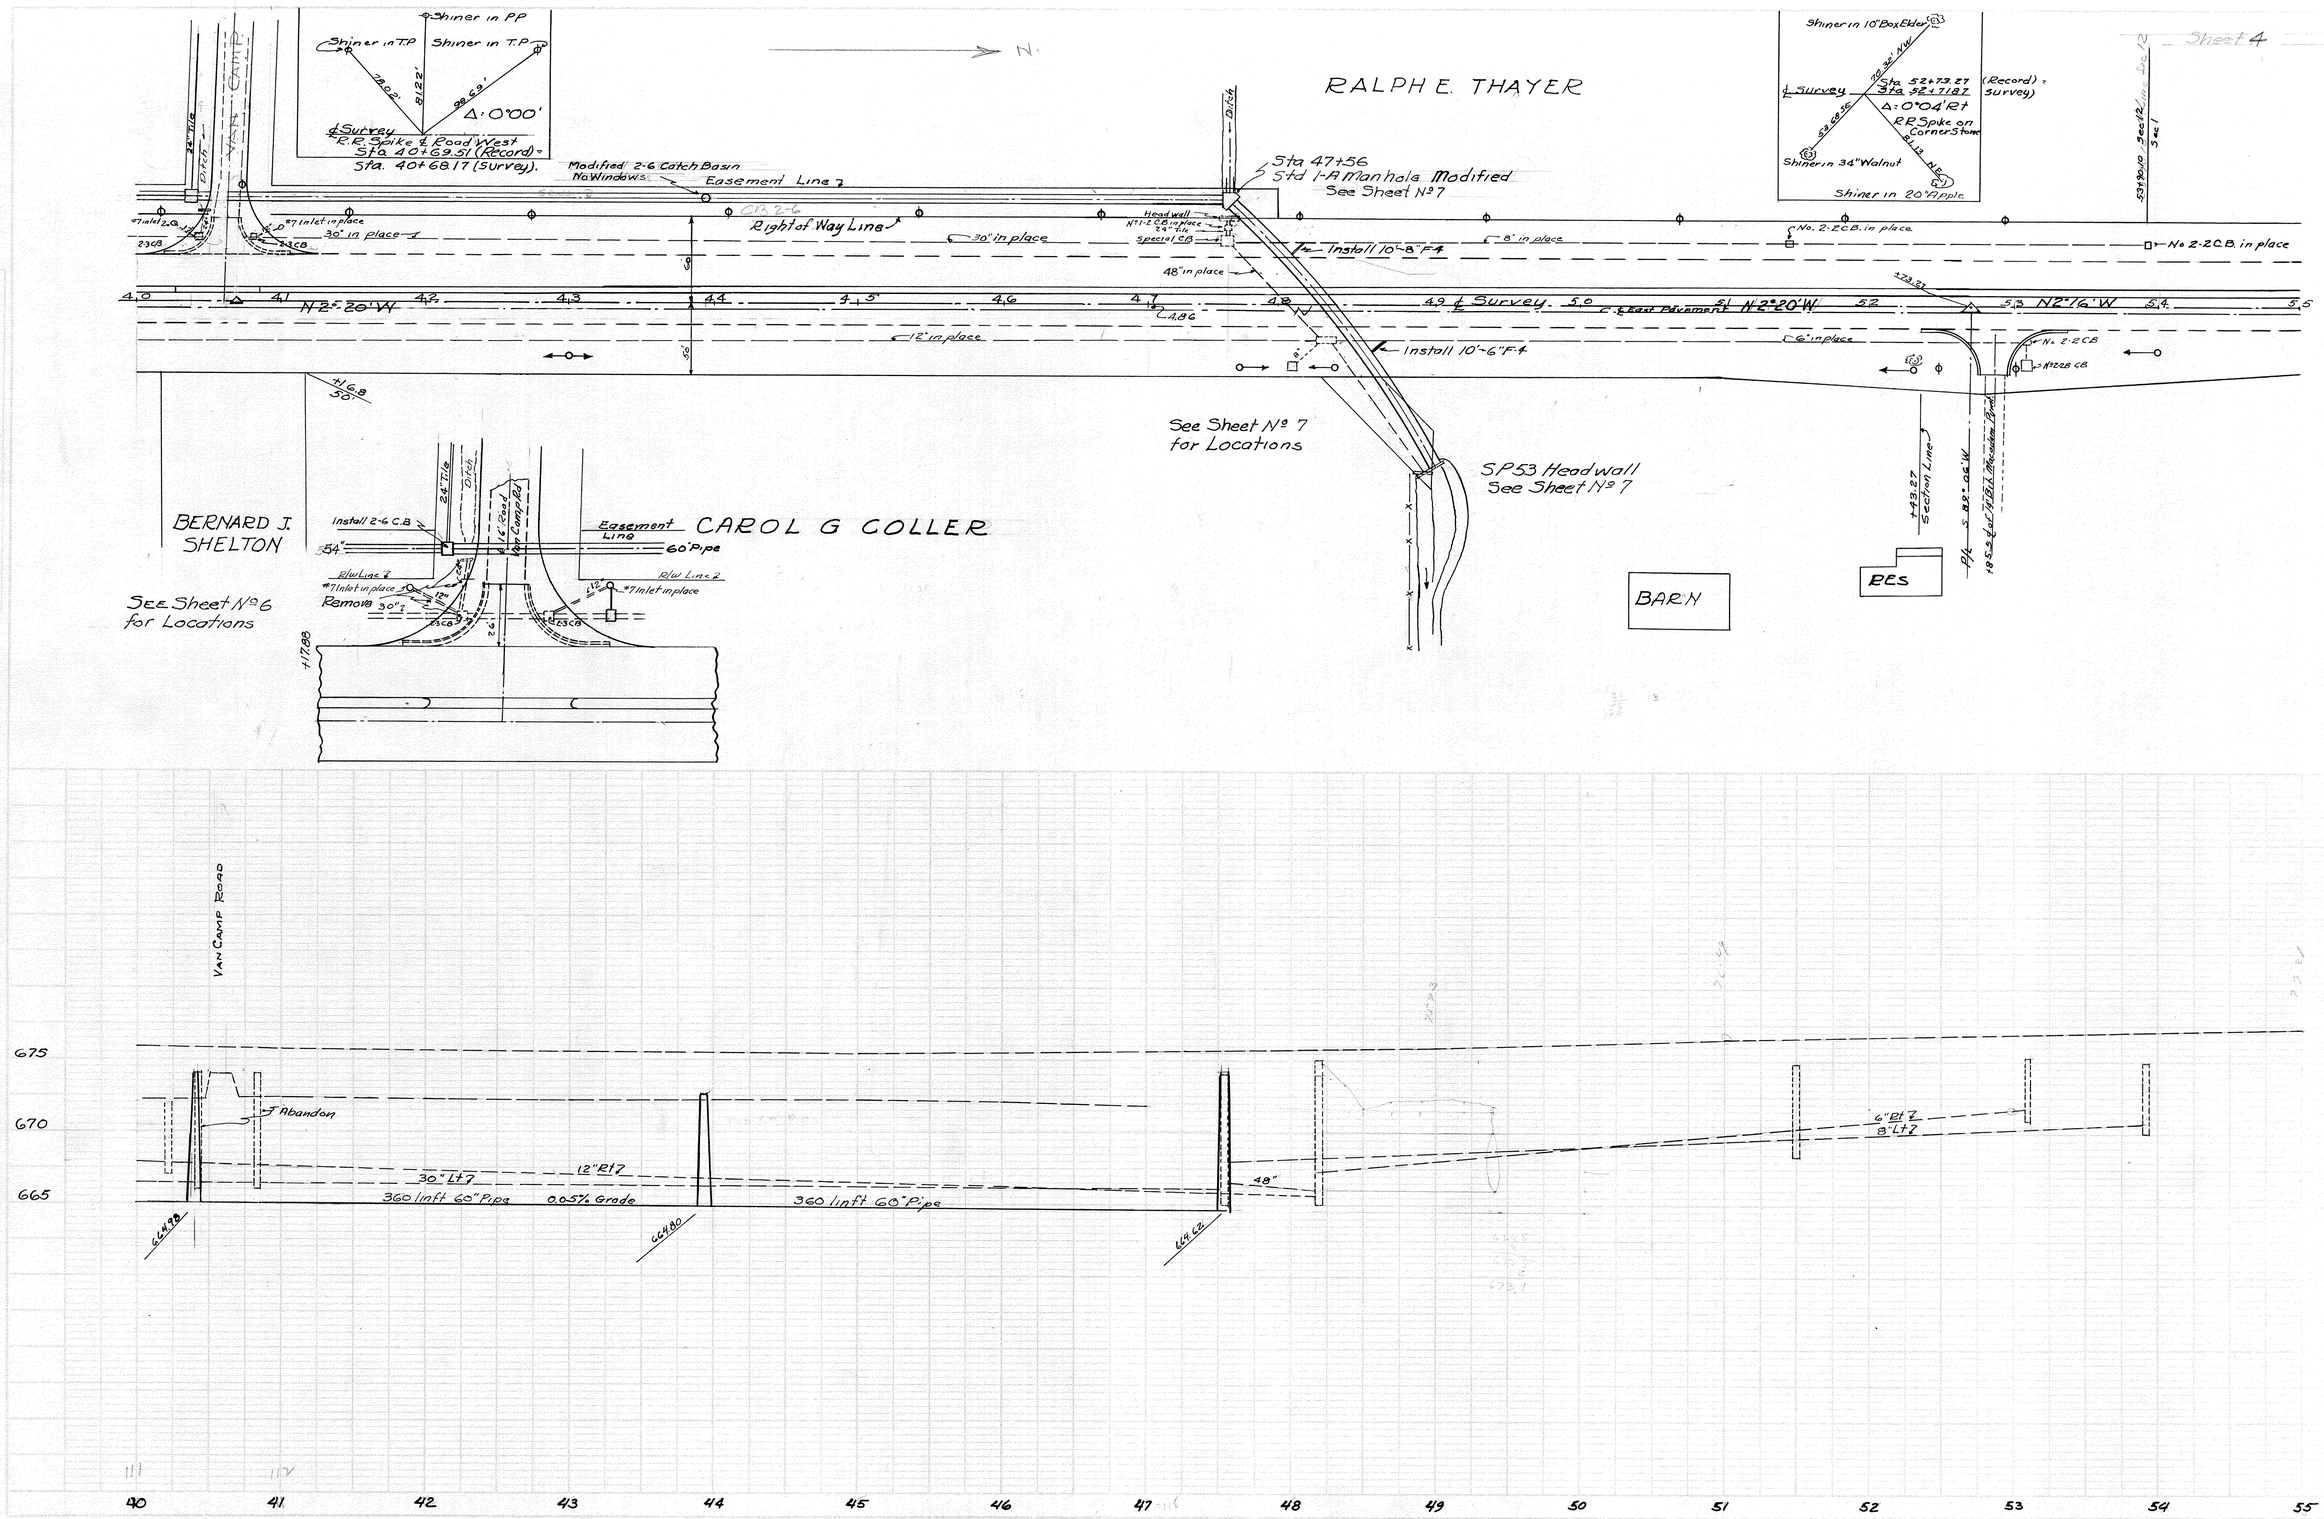
Sheet 4
N.
RALPH E. THAYER
Shiner in PP
Shiner in T.P
Shiner in T.P
Δ: 0°00'
℄ Survey
R.R. Spike ℄ Road West
Sta. 40+69.51 (Record)
Sta. 40+68.17 (Survey).
Shiner in 10" Box Elder
℄ Survey
Sta. 52+73.27 (Record)
Sta. 52+71.87 (Survey)
Δ: 0°04' Rt
R.R. Spike on Corner Stone
Shiner in 34" Walnut
Shiner in 20" Apple
Modified 2-6 Catch Basin
No Windows
Easement Line
Sta 47+56
Std 1-A Manhole Modified
See Sheet No 7
Right of Way Line
30" in place
Install 10'-8" F.4
8" in place
No. 2-2 C.B. in place
48" in place
12" in place
Install 10'-6" F.4
6" in place
No. 2-2 C.B.
No 2-2 C.B.
N 2°-20' W
℄ Survey
N 2°20' W
N 2°16' W
See Sheet No 7
for Locations
SP53 Headwall
See Sheet No 7
BERNARD J.
SHELTON
See Sheet No 6
for Locations
Install 2-6 C.B.
Easement Line
CAROL G COLLER
60" Pipe
R/W Line
#7 Inlet in place
Remove 30"
Section Line
BARN
PES
Van Camp Road
675
670
665
Abandon
30" Lt 7
12" Rt 7
360 lin ft 60" Pipe
0.05% Grade
360 lin ft 60" Pipe
48"
6" Rt 7
8" Lt 7
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55

SEP 30 1968