LAWRENCE FASTNACHT DITCH № 2248

MIDDLETON TWP. WOOD CO. OHIO

O. H. JONES ENGINEER.

Ditch Book 135

REVISED

Any tile ends damaged during construction shall be repaired by the contractor at his expence.

The contractor will spray all brush too small to cut, when stumps are sprayed

This will be a seperate bid item and must state the kind and strength of the material to be used.

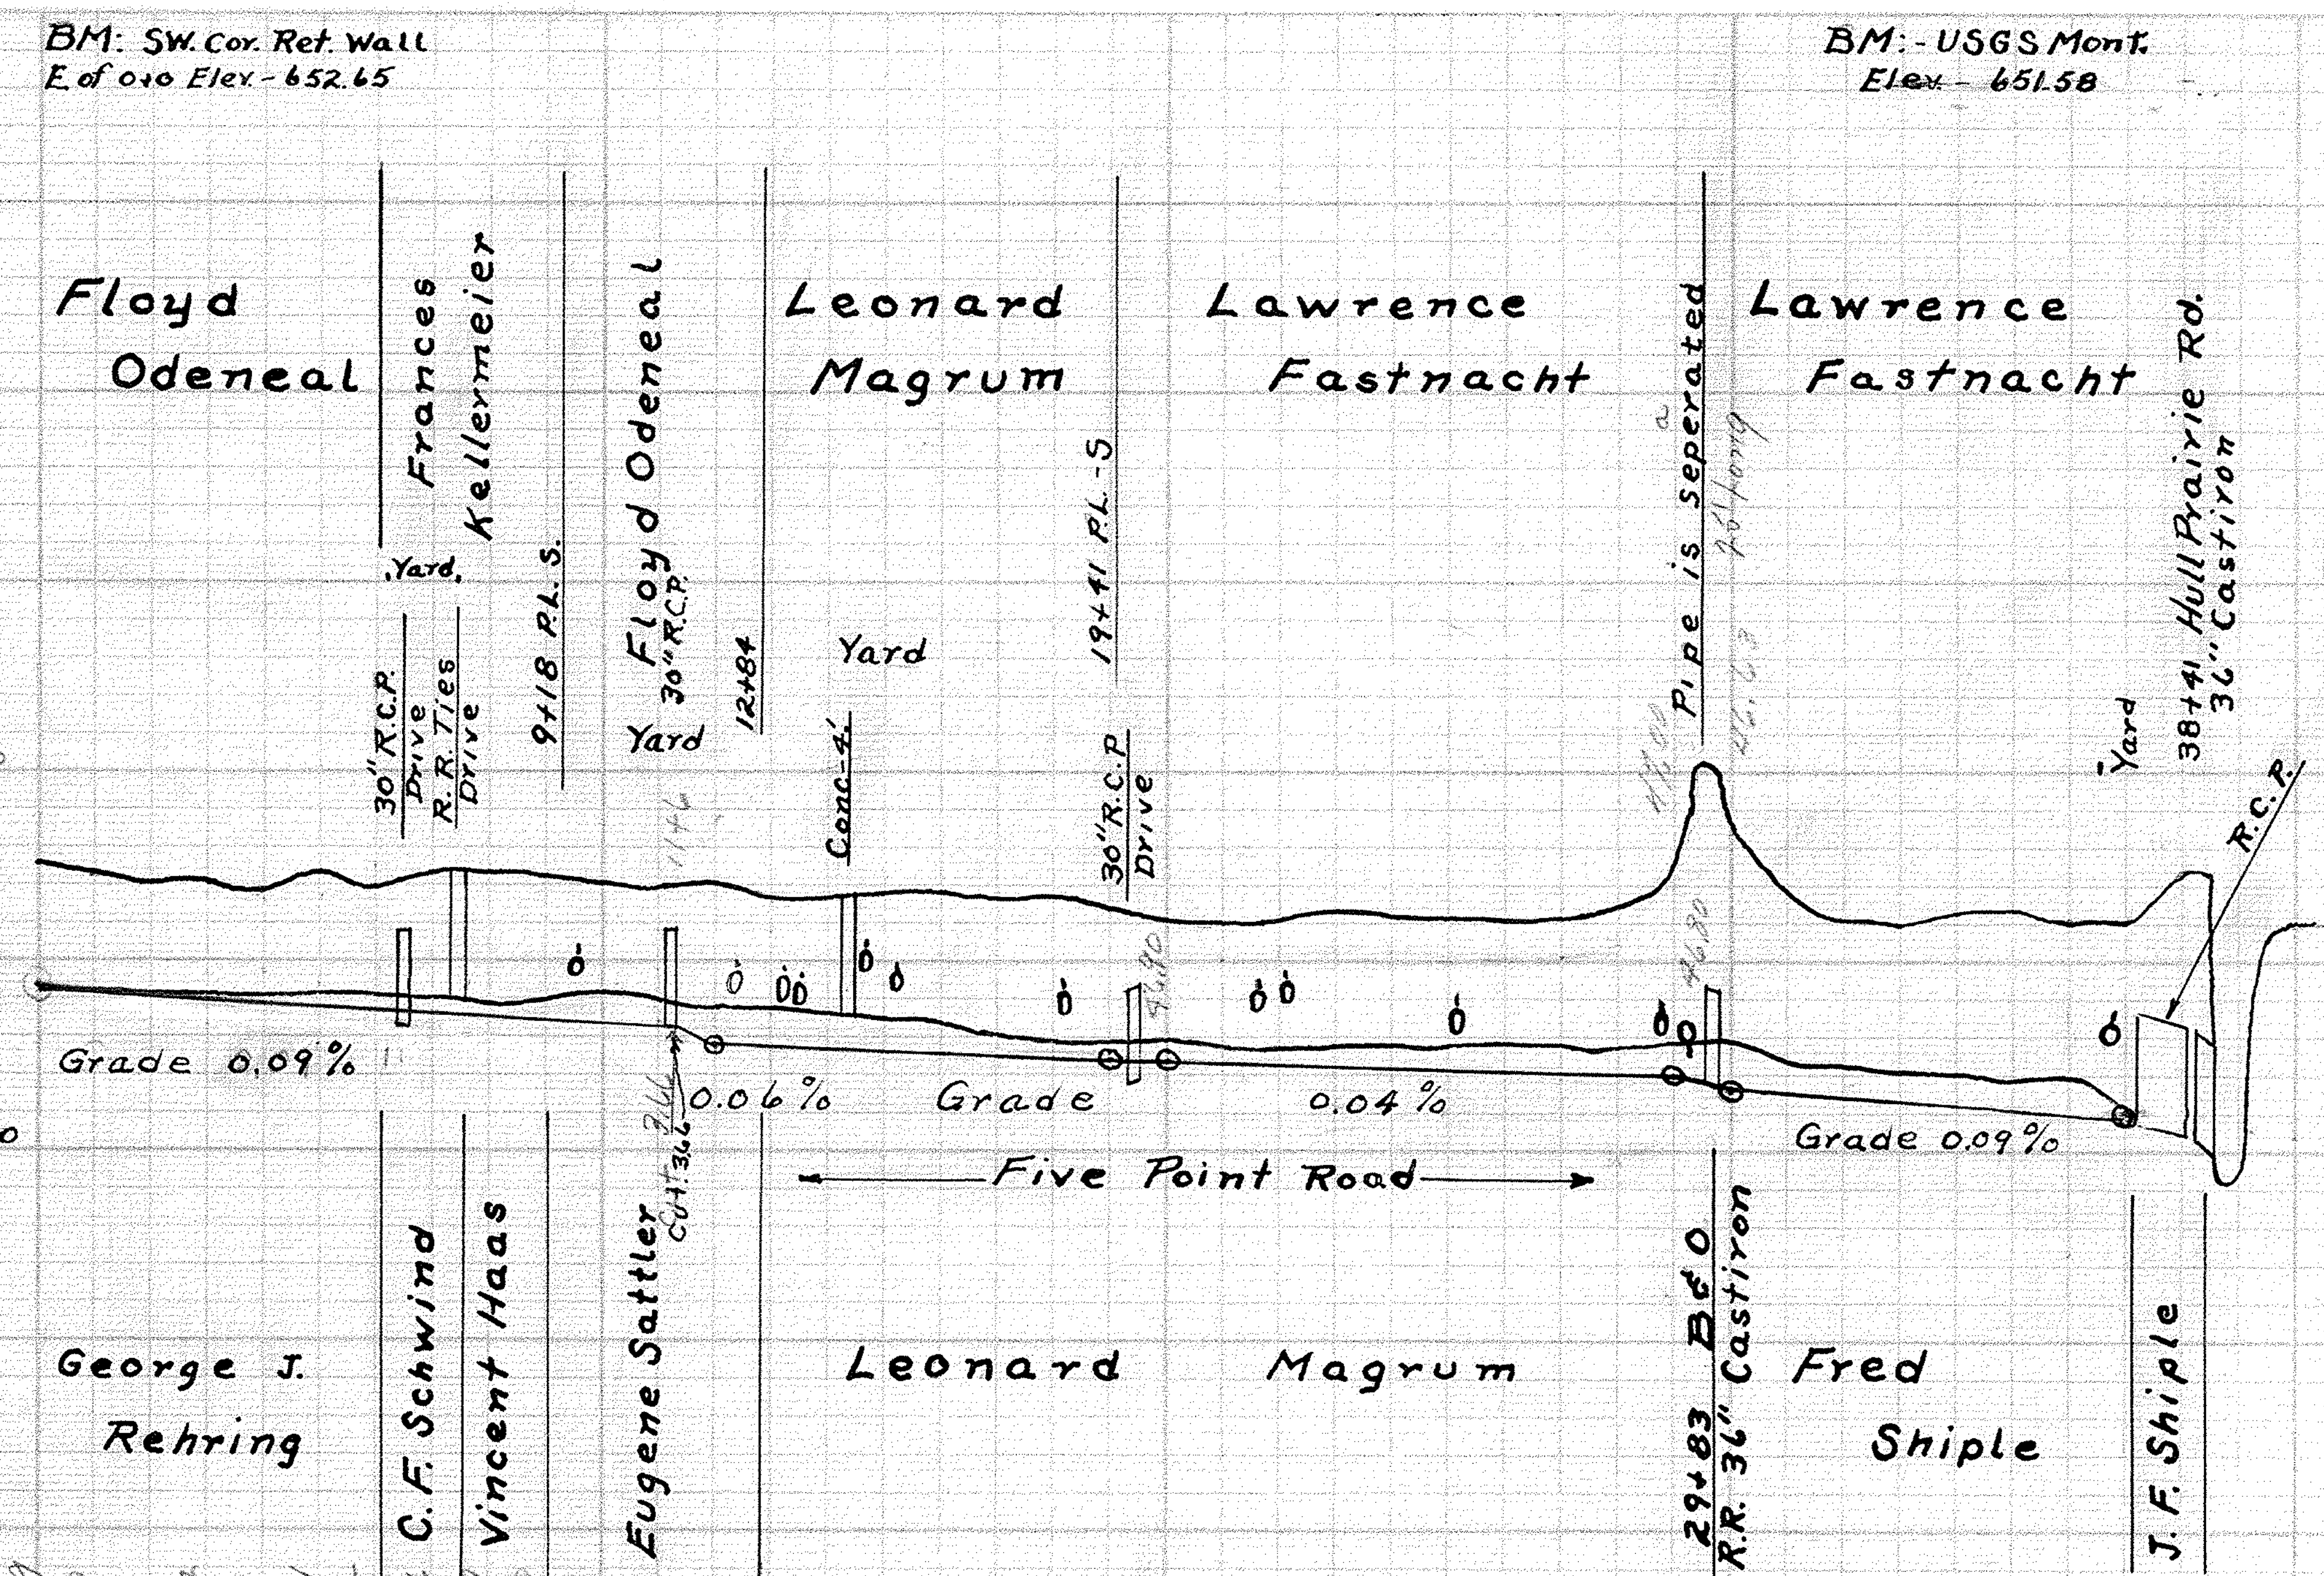

2' Bottom 1½ to 1 Slopes

Station	Ground	Grade	Cut	Yards
0	652.56	649.29	3.27	
1	652.28	649.20	3.08	
2	652.03	649.11	2.92	40
3	652.15	649.02	3.13	
4	651.82	648.93	2.89	40
5	652.43	648.84	3.59	
6	651.98	648.75	3.23	48
7	652.43	648.66	3.77	
8	652.31	648.57	3.74	60
9	652.25	648.48	3.77	
10	652.06	648.39	3.67	81
11	651.86	648.30	3.56	
12	651.98	647.83	4.15	89
13	651.71	647.77	3.94	
14	651.71	647.71	4.00	69
15	651.77	647.65	4.12	
16	651.93	647.59	4.34	57
17	651.65	647.53	4.12	
18	651.73	647.47	4.26	44
19	651.37	647.41	3.96	
20	651.19	647.36	3.83	40
21	651.01	647.32	3.69	
22	651.12	647.28	3.84	40
23	651.32	647.24	4.08	
24	651.18	647.20	3.98	41
25	651.22	647.16	4.06	
26	651.08	647.12	3.96	40
27	651.12	647.08	4.04	
28	651.46	647.04	4.42	40
29	652.35	647.00	5.35	
30	653.43	646.53	6.90	50
31	651.70	646.44	5.26	
32	651.06	646.35	4.71	62
33	650.99	646.26	4.73	
34	651.38	646.17	5.21	89
35	651.40	646.08	5.32	
36	651.09	645.99	5.10	83
37	651.03	645.90	5.13	37
		Total		1050