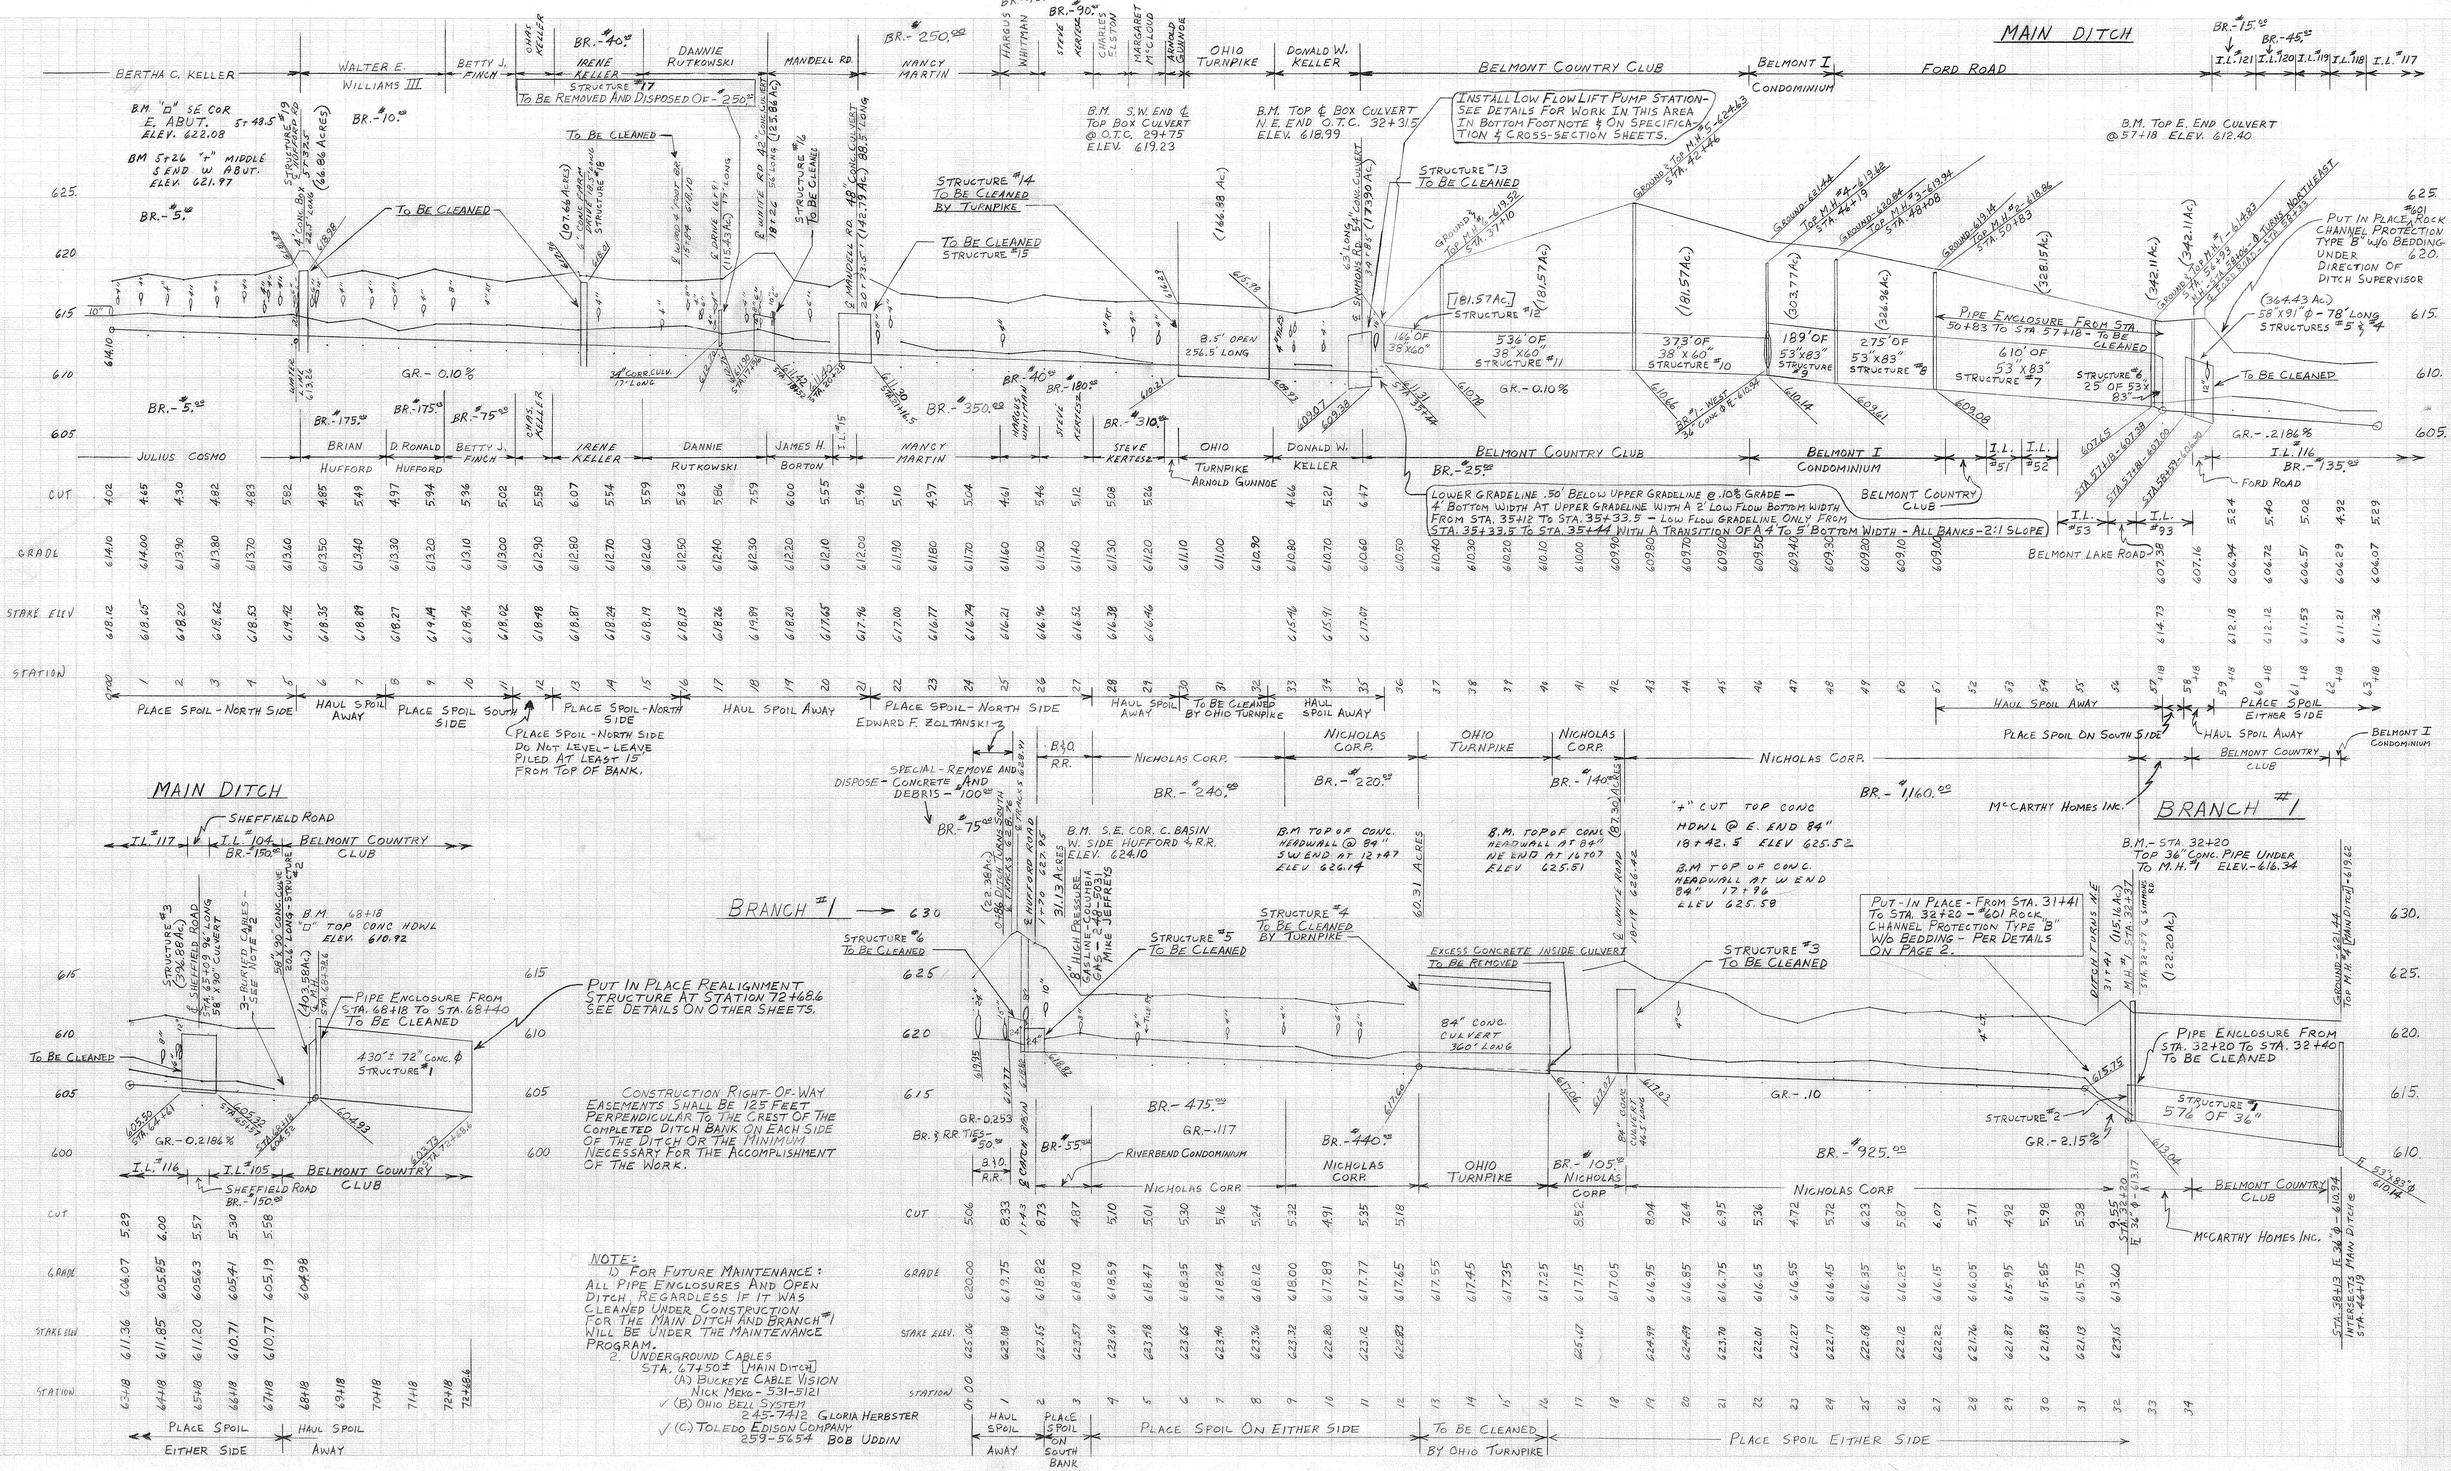
MAIN DITCH
BERTHA C. KELLER
WALTER E. WILLIAMS III
BETTY J. FINCH
CHAS. KELLER
IRENE KELLER
DANNIE RUTKOWSKI
MANDELL RD.
NANCY MARTIN
HARGUS WHITTAN
STEVE KERTESZ
CHARLES ELSTON
MARGARET McLOUD
ARNOLD GUNNOE
OHIO TURNPIKE
DONALD W. KELLER
BELMONT COUNTRY CLUB
BELMONT I CONDOMINIUM
FORD ROAD
JULIUS COSMO
BRIAN HUFFORD
D. RONALD HUFFORD
JAMES H. BORTON
STRUCTURE #17 TO BE REMOVED AND DISPOSED OF - 250±
TO BE CLEANED
STRUCTURE #14 TO BE CLEANED BY TURNPIKE
TO BE CLEANED STRUCTURE #15
INSTALL LOW FLOW LIFT PUMP STATION - SEE DETAILS FOR WORK IN THIS AREA IN BOTTOM FOOTNOTE & ON SPECIFICATION & CROSS-SECTION SHEETS.
STRUCTURE #13 TO BE CLEANED
B.M. "D" SE COR E. ABUT. STA. 48.5 ELEV. 622.08
BM STA 26 "F" MIDDLE S END W ABUT. ELEV. 621.97
B.M. S.W. END ℄ TOP BOX CULVERT @ O.T.C. 29+75 ELEV. 619.23
B.M. TOP ℄ BOX CULVERT N.E. END O.T.C. 32+31.5 ELEV. 618.99
B.M. TOP E. END CULVERT @ 57+18 ELEV. 612.40
PIPE ENCLOSURE FROM STA. 50+83 TO STA. 57+18 - TO BE CLEANED
PUT IN PLACE ROCK CHANNEL PROTECTION TYPE "B" W/o BEDDING UNDER DIRECTION OF DITCH SUPERVISOR
GR. - 0.10%
GR. - .2186%
LOWER GRADELINE .50' BELOW UPPER GRADELINE @ .10% GRADE - 4' BOTTOM WIDTH AT UPPER GRADELINE WITH A 2' LOW FLOW BOTTOM WIDTH FROM STA. 35+12 TO STA. 35+33.5 - LOW FLOW GRADELINE ONLY FROM STA. 35+33.5 TO STA. 35+44 WITH A TRANSITION OF A 4' TO 5' BOTTOM WIDTH - ALL BANKS - 2:1 SLOPE
BELMONT LAKE ROAD
CUT
GRADE
STAKE ELEV
STATION
PLACE SPOIL - NORTH SIDE
HAUL SPOIL AWAY
PLACE SPOIL SOUTH SIDE
PLACE SPOIL - NORTH SIDE DO NOT LEVEL - LEAVE PILED AT LEAST 15' FROM TOP OF BANK.
HAUL SPOIL AWAY TO BE CLEANED BY OHIO TURNPIKE
PLACE SPOIL ON SOUTH SIDE
HAUL SPOIL AWAY
PLACE SPOIL EITHER SIDE
EDWARD F. ZOLTANSKI
NICHOLAS CORP.
McCARTHY HOMES INC.
BRANCH #1
MAIN DITCH
SHEFFIELD ROAD
BELMONT COUNTRY CLUB
PIPE ENCLOSURE FROM STA. 68+18 TO STA. 68+40 TO BE CLEANED
430'± 72" CONC. ℄ STRUCTURE #1
PUT IN PLACE REALIGNMENT STRUCTURE AT STATION 72+68.6 SEE DETAILS ON OTHER SHEETS.
CONSTRUCTION RIGHT-OF-WAY EASEMENTS SHALL BE 125 FEET PERPENDICULAR TO THE CREST OF THE COMPLETED DITCH BANK ON EACH SIDE OF THE DITCH OR THE MINIMUM NECESSARY FOR THE ACCOMPLISHMENT OF THE WORK.
NOTE:
1) FOR FUTURE MAINTENANCE: ALL PIPE ENCLOSURES AND OPEN DITCH, REGARDLESS IF IT WAS CLEANED UNDER CONSTRUCTION FOR THE MAIN DITCH AND BRANCH #1 WILL BE UNDER THE MAINTENANCE PROGRAM.
2. UNDERGROUND CABLES
STA. 67+50± [MAIN DITCH]
(A) BUCKEYE CABLE VISION NICK MEKO - 531-5121
✓ (B) OHIO BELL SYSTEM 245-7412 GLORIA HERBSTER
✓ (C) TOLEDO EDISON COMPANY 259-5654 BOB UDDIN
PUT-IN PLACE - FROM STA. 31+41 TO STA. 32+20 - #601 ROCK CHANNEL PROTECTION TYPE "B" W/o BEDDING - PER DETAILS ON PAGE 2.
PIPE ENCLOSURE FROM STA. 32+20 TO STA. 32+40 TO BE CLEANED
EXCESS CONCRETE INSIDE CULVERT TO BE REMOVED
84" CONC. CULVERT 360' LONG
STRUCTURE #4 TO BE CLEANED BY TURNPIKE
STRUCTURE #5 TO BE CLEANED
STRUCTURE #6 TO BE CLEANED
STRUCTURE #3 TO BE CLEANED
STRUCTURE #2
STRUCTURE #1
RIVERBEND CONDOMINIUM
PLACE SPOIL EITHER SIDE
HAUL SPOIL AWAY
PLACE SPOIL ON SOUTH BANK
PLACE SPOIL ON EITHER SIDE
TO BE CLEANED BY OHIO TURNPIKE
PLACE SPOIL EITHER SIDE